


W90

Elbows 90°



PE 100 SDR 11

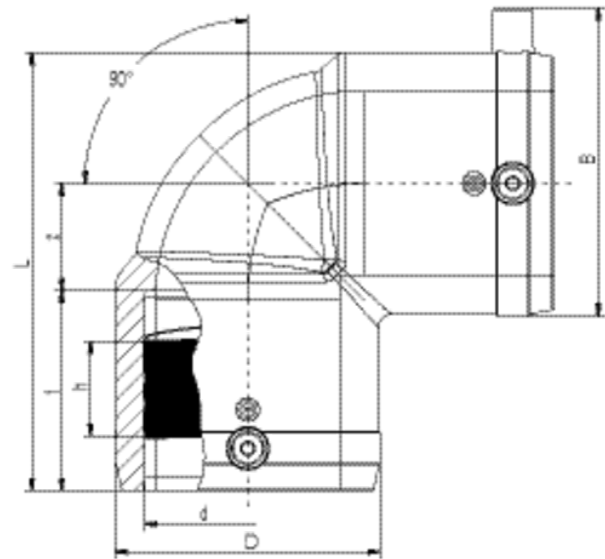

Maximum working pressure 16 bar (water)/10 bar (gas)

	SKU	d	BX	PU	D	L	t	z	h	B	Weight kg
1	616686	20	200	3200	28,5	71	30	12	16	41	0,040
	612091	25	60	1920	37	73	40	15	19	54	0,060
	612093	32	50	1600	43	82	44	16	21	61	0,070
	612095	40	30	960	53	96	49	21	29	70	0,110
	612097	50	20	640	66	113	55	26	32	81	0,190
	612099	63	10	320	83	136	62	33	30	96	0,340
	612101	75	12	216	96	170	70	53	37	111	0,600
	612103	90	6	108	115	202	75	65	45	128	0,950
	612105	110	10	80	138	234	81	84	50	150	1,560
	612107	125	8	64	157	254	87	89	44	167	2,030
	615276	160	3	24	207	329	92	133	44	210	4,850
	615689	180	3	24	228	354	94	146	65	229	5,760
	616265	200	2	16	254	392	106	159	54	256	8,557
	615690	225	1	8	280	430	113	177	66	281	10,220

¹ Design deviates from product description

 FRIALEN-Safety Fittings can be fused to pipes of SDR stages 11 to 17.6. Minimum wall thickness $s_{min} \geq 3$ mm. Other SDR-stages on request. Please observe the marking directly at the product, which is mandatory. DVGW-Registration Nos.: DV-8601AU2248 and DV-8606AU2249

W90**FRIALEN Safety Fittings**

Elbows 90°

Areas of Application

The FRIALEN-Elbow W90° is used for all changes of direction in HD-PE pipes.

Assembly Instructions

The fusion of the pipe ends with the FRIALEN-Elbows W90° takes place by FRIALEN-fusing – leakproof and longitudinally strong.

The pipe ends are prepared according to the general installation instructions (see "Assembly Instructions" for "FRIALEN-Safety Fittings for house connections and distribution pipes up to d 225"). This involves removing the oxide skin and cleaning the pipe ends.

W90

Elbows 90°

Good reasons for using the FRIALEN-Elbows W90°:

Large coupler depth for ease of pipe guiding (no holding clamps required)

Extra wide fusion zones

Maximum stability through great wall thickness

Cold zones at the front side and in the middle of the coupler

Exposed heating coil for direct heat transmission to the pipe

Small annular gap for build-up of optimum joining pressure in the fusion zone

Contacts safe to touch

Fusion indicator for visual fusion control

Durable batch marking

Individually wrapped for dirt protection

Additional barcode for tracing back the fitting (Traceability-Coding)